

INSPECT
REPORT
IMPROVE

BUILDINGS
PEOPLE
LASTING VALUE



FEDARI

PROPERTY CARE. PERFECTED.

Low: 25

Medium: 52

High: 11

INSPECTION REPORT



Prepared by

Fedari Building Inspection L.L.C.



/ Bedroom 1

#189 - AC supply and return air grilles require cleaning to remove accumulated dust and dirt.

Open

Assigned To : **ONSITE**

x:492 / y:371

High

Due Date: **Wednesday, October 21, 2026** 8 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



#161 - Chipped paint corner

Open

Assigned To : **ONSITE**

x:463 / y:321

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



#162 - Crack door sealant

Open

Assigned To : **ONSITE**

x:462 / y:396

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



#159 - Paint touch ups

Open

Assigned To : **ONSITE**

x:472 / y:360

Medium

Due Date: **Saturday, October 24, 2026**

11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



#160 - Hollow tiles

Open

Assigned To : **ONSITE**

x:547 / y:344

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



#157 - Chipped corner

Open

Assigned To : **ONSITE**

x:558 / y:408

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



#158 - Excessive paint around corners

Open

Assigned To : **ONSITE**

x:524 / y:399

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



#156 - Light is working normally

Open

Assigned To : **ONSITE**

x:470 / y:280

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Lighting

General snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



#155 - Rubber sealant is peeling off

Open

Assigned To : **ONSITE**

x:504 / y:238

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



#154 - Visible scratches on sliding glass door

Open

Assigned To : **ONSITE**

x:575 / y:300

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



#153 - Thermal image showing no air leakage

Open

Assigned To : **ONSITE**

x:474 / y:255

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



#151 - AC is not working normally

Open

Assigned To : **ONSITE**

x:524 / y:258

High

Due Date: **Wednesday, October 21, 2026** 8 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



#152 - Socket is working normally

Open

Assigned To : **ONSITE**

x:546 / y:271

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Switches & Sockets

General snag

Location :

Created by/on :

Bedroom 1

(Fedari)

14/10/2026 12:14



/ Bedroom 1 Bathroom

#167 - Not fixed properly

Open

Assigned To : **ONSITE**

x:569 / y:460

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 1 Bathroom

(Fedari)

14/10/2026 12:14



#168 - Corners glass is scratched

Open

Assigned To : **ONSITE**

x:576 / y:464

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 1 Bathroom

(Fedari)

14/10/2026 12:14



#165 - Light is working normally

Open

Assigned To : **ONSITE**

x:534 / y:495

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Lighting

General snag

Location :

Created by/on :

Bedroom 1 Bathroom

(Fedari)

14/10/2026 12:14



#166 - Exhaust fan system is not functional

Open

Assigned To : **ONSITE**

x:561 / y:498

High

Due Date: **Wednesday, October 21, 2026** 8 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Bedroom 1 Bathroom

(Fedari)

14/10/2026 12:14



#163 - Loose fixture

Open

Assigned To : **ONSITE**

x:501 / y:503

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 1 Bathroom

(Fedari)

14/10/2026 12:14



#164 - Door is wobbly when closed

Open

Assigned To : **ONSITE**

x:500 / y:443

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 1 Bathroom

(Fedari)

14/10/2026 12:14



/ Bedroom 2

#188 - AC supply and return air grilles require cleaning to remove accumulated dust and dirt.

Open

Assigned To : **ONSITE**

x:186 / y:389

High

Due Date: **Wednesday, October 21, 2026** 8 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Bedroom 2

(Fedari)

14/10/2026 12:14



#177 - Paint touch ups

Open

Assigned To : **ONSITE**

x:212 / y:370

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 2

(Fedari)

14/10/2026 12:14



#178 - Improper paint finishing around corners

Open

Assigned To : **ONSITE**

x:214 / y:334

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 2

(Fedari)

14/10/2026 12:14



#176 - Visible crack repair

Open

Assigned To : **ONSITE**

x:126 / y:287

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 2

(Fedari)

14/10/2026 12:14



#175 - Excessive paint around corners

Open

Assigned To : **ONSITE**

x:121 / y:355

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 2

(Fedari)

14/10/2026 12:14



#174 - Shutter touching the wall

Open

Assigned To : **ONSITE**

x:138 / y:387

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 2

(Fedari)

14/10/2026 12:14



#173 - Misaligned shutter

Open

Assigned To : **ONSITE**

x:165 / y:396

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 2

(Fedari)

14/10/2026 12:14



#172 - Light is working normally

Open

Assigned To : **ONSITE**

x:222 / y:289

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Lighting

General snag

Location :

Created by/on :

Bedroom 2

(Fedari)

14/10/2026 12:14



#171 - Socket is working normally

Open

Assigned To : **ONSITE**

x:227 / y:255

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Switches & Sockets

General snag

Location :

Created by/on :

Bedroom 2

(Fedari)

14/10/2026 12:14



#169 - AC is not working normally

Open

Assigned To : **ONSITE**

x:196 / y:296

High

Due Date: **Wednesday, October 21, 2026** 8 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Bedroom 2

(Fedari)

14/10/2026 12:14



#170 - Thermal image showing no air leakage

Open

Assigned To : **ONSITE**

x:197 / y:257

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Bedroom 2

(Fedari)

14/10/2026 12:14



/ Bedroom 2 Bathroom

#183 - Exhaust fan system is not functional

Open

Assigned To : **ONSITE**

x:120 / y:433

High

Due Date: **Wednesday, October 21, 2026** 8 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Bedroom 2 Bathroom

(Fedari)

14/10/2026 12:14



#181 - Loose fixture

Open

Assigned To : **ONSITE**

x:142 / y:442

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 2 Bathroom

(Fedari)

14/10/2026 12:14



#182 - Light is working normally

Open

Assigned To : **ONSITE**

x:163 / y:459

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Lighting

General snag

Location :

Created by/on :

Bedroom 2 Bathroom

(Fedari)

14/10/2026 12:14



#180 - Loose seat cover

Open

Assigned To : **ONSITE**

x:136 / y:502

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 2 Bathroom

(Fedari)

14/10/2026 12:14



#179 - Shower glass door collides with the shower head when closing and requires adjustment to ensure smooth operation.

Open

Assigned To : **ONSITE**

x:170 / y:500

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Bedroom 2 Bathroom

(Fedari)

14/10/2026 12:14



/ Blacony

#150 - General comment for balcony railing : Should be dust and scratches free

Open

Assigned To : **ONSITE**

x:238 / y:162

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Blacony

(Fedari)

14/10/2026 12:14



#148 - Light is working normally

Open

Assigned To : **ONSITE**

x:300 / y:160

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Lighting

General snag

Location :

Created by/on :

Blacony

(Fedari)

14/10/2026 12:14



#149 - Railing is shaky upon inspection

Open

Assigned To : **ONSITE**

x:294 / y:194

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Blacony

(Fedari)

14/10/2026 12:14



#147 - Hollow tiles

Open

Assigned To : **ONSITE**

x:401 / y:171

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Blacony

(Fedari)

14/10/2026 12:14



/ Entrance

#126 - Hollow tiles

Open

Assigned To : **ONSITE**

x:357 / y:572

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Entrance

(Fedari)

14/10/2026 12:14



#125 - Light is working normally

Open

Assigned To : **ONSITE**

x:379 / y:567

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Lighting

General snag

Location :

Created by/on :

Entrance

(Fedari)

14/10/2026 12:14



#124 - Door touch ups

Open

Assigned To : **ONSITE**

x:391 / y:599

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Entrance

(Fedari)

14/10/2026 12:14



/ Kitchen

#192 - Pantry top corner look aligned

Open

Assigned To : **ONSITE**

x:256 / y:517

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:14



#190 - Wall moisture looks low

Open

Assigned To : **ONSITE**

x:345 / y:539

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:14



#191 - Wooden moisture looks low

Open

Assigned To : **ONSITE**

x:356 / y:510

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:14



#186 - Visible scratches on sink

Open

Assigned To : **ONSITE**

x:267 / y:509

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:14



#187 - Water supply lines are not working in all apartment , Water heater is not working in all apartment

Open

Assigned To : **ONSITE**

x:232 / y:488

High

Due Date: **Wednesday, October 21, 2026** 8 days

- MEP - Mechanical - Water Supply / PPR

General snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:14



#123 - Paint touch ups required

Open

Assigned To : **ONSITE**

x:316 / y:564

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:14



#122 - Pending Installation

Open

Assigned To : **ONSITE**

x:218 / y:568

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:14



#120 - Hollow tile

Open

Assigned To : **ONSITE**

x:214 / y:610

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:14



#121 - Oven is connected at time of inspection

Open

Assigned To : **ONSITE**

x:276 / y:513

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP-Electrical - General Snag

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:14



#118 - Fridge is working normally

Open

Assigned To : **ONSITE**

x:299 / y:600

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP-Electrical - General Snag

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:14



#119 - Improper grouting around the corners

Open

Assigned To : **ONSITE**

x:237 / y:537

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:14



#117 - Inconsistent sealant application around the conrers

Open

Assigned To : **ONSITE**

x:258 / y:603

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



#115 - Missing sealant application around the corners

Open

Assigned To : **ONSITE**

x:323 / y:609

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



#116 - Rough edges

Open

Assigned To : **ONSITE**

x:333 / y:493

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



#113 - Shutter is clashing with the wall

Open

Assigned To : **ONSITE**

x:308 / y:510

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



#114 - Chipped corners

Open

Assigned To : **ONSITE**

x:321 / y:529

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



#111 - Chipped corners

Open

Assigned To : **ONSITE**

x:291 / y:502

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



#112 - Improper sealant application

Open

Assigned To : **ONSITE**

x:315 / y:596

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



#110 - Visible scratches on the kitchen cabinet

Open

Assigned To : **ONSITE**

x:276 / y:584

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



#108 - Visible scratches on the socket

Open

Assigned To : **ONSITE**

x:243 / y:566

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



#109 - Misaligned shutter cabinets

Open

Assigned To : **ONSITE**

x:245 / y:591

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



#106 - Kitchen hood is making noise

Open

Assigned To : **ONSITE**

x:232 / y:504

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



#107 - Socket is working normally

Open

Assigned To : **ONSITE**

x:247 / y:523

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Switches & Sockets

General snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



#105 - Light is working normally

Open

Assigned To : **ONSITE**

x:263 / y:499

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Lighting

General snag

Location :

Created by/on :

Kitchen

(Fedari)

14/10/2026 12:13



/ Laundry Area

#134 - Washing machine connection not done properly

Open

Assigned To : **ONSITE**

x:409 / y:515

High

Due Date: **Wednesday, October 21, 2026** 8 days

- MEP-Electrical - General Snag

General Snag

Location :

Created by/on :

Laundry Area

(Fedari)

14/10/2026 12:14



#133 - Light is working normally

Open

Assigned To : **ONSITE**

x:416 / y:494

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Lighting

General snag

Location :

Created by/on :

Laundry Area

(Fedari)

14/10/2026 12:14



/ Living

#184 - AC is causing some noise

Open

Assigned To : **ONSITE**

x:294 / y:378

High

Due Date: **Wednesday, October 21, 2026** 8 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14



#185 - AC grills looks clean

Open

Assigned To : **ONSITE**

x:289 / y:339

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14



#146 - Rubber sealant is peeling off

Open

Assigned To : **ONSITE**

x:359 / y:231

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14



#144 - AC is working normally

Open

Assigned To : **ONSITE**

x:349 / y:285

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14



#145 - Thermal image showing no air leakage

Open

Assigned To : **ONSITE**

x:325 / y:241

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP-Mechanical - General Snag

General Snag


Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14

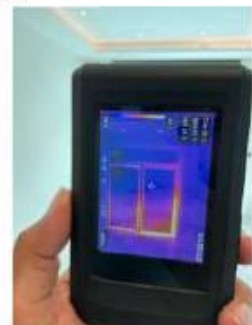

#143 - Loose socket covers

Open

Assigned To : **ONSITE**

x:385 / y:288

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14



#142 - Socket is working normally

Open

Assigned To : **ONSITE**

x:389 / y:328

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Switches & Sockets

General snag

Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14



#140 - Hollow tile

Open

Assigned To : **ONSITE**

x:330 / y:407

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14



#141 - Light is working normally

Open

Assigned To : **ONSITE**

x:372 / y:362

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Lighting

General snag

Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14



#139 - DB temperature looks high

Open

Assigned To : **ONSITE**

x:376 / y:439

High

Due Date: **Wednesday, October 21, 2026** 8 days

- MEP-Electrical - General Snag

General Snag

Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14



#138 - Visible crack on the wall

Open

Assigned To : **ONSITE**

x:394 / y:420

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14



#136 - Paint touch ups

Open

Assigned To : **ONSITE**

x:356 / y:404

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14



#137 - ONU box key not provided

Open

Assigned To : **ONSITE**

x:389 / y:395

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Living

(Fedari)

14/10/2026 12:14



/ Powder Room

#135 - Exhaust fan system is not working normally

Open

Assigned To : **ONSITE**

x:441 / y:550

High

Due Date: **Wednesday, October 21, 2026** 8 days

- MEP-Mechanical - General Snag

General Snag

Location :

Created by/on :

Powder Room

(Fedari)

14/10/2026 12:14



#132 - Paint touch ups

Open

Assigned To : **ONSITE**

x:428 / y:599

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Powder Room

(Fedari)

14/10/2026 12:14



#131 - Door is wobbly when closed

Open

Assigned To : **ONSITE**

x:427 / y:544

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Powder Room

(Fedari)

14/10/2026 12:14



#130 - Loose fixture

Open

Assigned To : **ONSITE**

x:471 / y:604

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Powder Room

(Fedari)

14/10/2026 12:14



#128 - Excessive grouting application

Open

Assigned To : **ONSITE**

x:450 / y:605

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Powder Room

(Fedari)

14/10/2026 12:14



#129 - Light is working normally

Open

Assigned To : **ONSITE**

x:471 / y:571

Low

Due Date: **Wednesday, November 4, 2026** 22 days

- MEP - Electrical - Lighting

General snag

Location :

Created by/on :

Powder Room

(Fedari)

14/10/2026 12:14



#127 - Rough edges

Open

Assigned To : **ONSITE**

x:465 / y:543

Medium

Due Date: **Saturday, October 24, 2026** 11 days

- Architectural - General

General Snag

Location :

Created by/on :

Powder Room

(Fedari)

14/10/2026 12:14

